

Teleflex Medical
 IDA Business & Technology Park,
 Dublin Road, Athlone
 Westmeath, Ireland

April-2024

URGENT – FIELD SAFETY NOTICE

Type of Action	Advisory Notice			
Product Name	Arrow® FiberOptix™ Intra-Aortic Balloon Catheter Kit Arrow® UltraFlex™ Intra-Aortic Balloon Catheter Kit			
Teleflex Reference	EIF-000561			
Product Code	IAB-05830-LWS	IAB-05830-U	IAB-05840-LWS	IAB-05840-U
	IAB-05850-LWS	IAB-06830-U	IAB-06840-U	IAB-06850-U
Batch / Lot Number:	Refer to Appendix 2			
Unique Device Identifier (UDI)				

Dear Customer,

Details of affected devices

Arrow International LLC, a subsidiary of Teleflex Incorporated (collectively “Teleflex”), has initiated a voluntary Field Safety Corrective Action (“FSCA”) for the above listed products; refer to Appendix 2 for Product Code, lot number and Unique Device Identifier (UDI) information.

Description of the issue & immediate actions required

Teleflex is initiating this voluntary FSCA for the above-mentioned products due to reports indicating an infrequent condition that, **when not identified and corrected promptly, could result in serious health consequences.** The issue may manifest as:

- failure of the intra-aortic balloon to completely inflate over its full length
- damaged or broken central lumen in the segment contained within the balloon
- helium loss or blood in the helium pathway.

Possible consequences of the above issue include a reduction or loss of the hemodynamic support normally provided by IABP therapy. This would require immediate replacement of the device resulting in delay or temporary interruption of IABP therapy. **Therefore, this condition could result in an increased risk of hemodynamic or ischemic complications, including death.** Between 05-April-2022 and 05-April-2024, a total of 337 reports of the above-mentioned conditions have been received. This includes reports of 31 injuries and 3 deaths. As reported, two of the three deaths were unrelated to the issue and the patient death occurred several days later. In the third event, the patient death may or may not have been related; the device was used in profound cardiogenic shock with repeated red-condition alarms.

Actions to detect this issue:

1. Prior to use, **ensure that a back up IAB catheter is available**, in the event that a replacement device is needed.
2. Prior to insertion, **users should inspect all in-scope IAB catheters** for signs of an over-twisted balloon wrap or bent balloon shaft. Over-twisting manifests as a progressive pitch or tightness within the helical wrap at either the distal or proximal end of the balloon. Examples of correct wrap versus over-twisted wrap are shown in images 1a & 1b below. Do not insert catheters suspected of manifesting an over-twisted wrap. **However, not all affected catheters will manifest with a visibly over-twisted balloon wrap.**

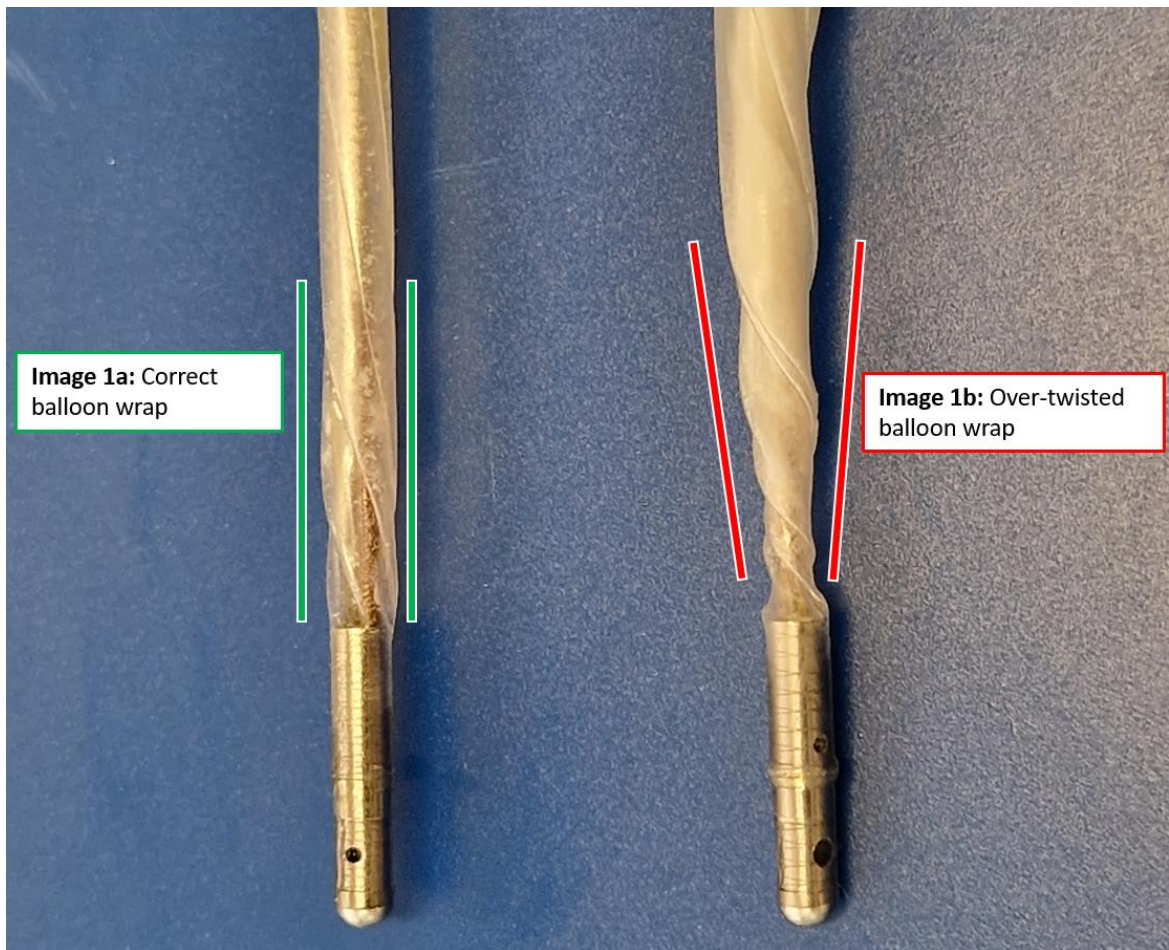


Image 1

3. All in-scope IAB catheters must be inserted under fluoroscopic guidance. Once inserted and connected, **fluoroscopy must be used to assess the completeness of balloon inflation**. The fluoroscopic assessment must span the full length of the balloon (panning as necessary) and should include several cycles of inflation/deflation. Intermittent fluoroscopy should remain available for up to 3 minutes after one-to-one cyclic counterpulsation begins, or until full balloon inflation is confirmed.
4. As always, users should be vigilant in responding to pump alarms consistent with the Instructions For Use and Users Guide.
 - In the event an Arrow AC3 or Autocat-2 pump is being used, a **high-pressure alarm** or **high baseline alarm** may sound and display on the pump console. These red-condition alarms require immediate attention per the Instructions For Use and Users Guide. The alarms provide users with a trouble shooting algorithm that includes incomplete IAB inflation.
 - In the event a Getinge CardioSave pump is being used, an **IAB catheter restriction** alarm may sound.
 - Any pump **alarm indicating helium leakage (helium loss or gas loss)** may signal the IAB catheter is not performing as expected.
 - As always, real-time telephone support for Arrow IABPs and IAB catheters is available at the Patient Care Support contact details below.
5. As always, users should be vigilant in responding to bedside indicators that an IAB catheter is not performing as expected, including:
 - Blood in the helium pathway
 - Lower than expected diastolic pressure augmentation

Immediate actions if this issue is identified:

If an IAB catheter is suspected of having this issue, based upon any of the above features, the catheter should be removed and replaced using steps outlined in the Instructions for Use. A replacement balloon catheter may be inserted contralaterally or ipsilaterally as determined by the responsible physician after considering the patient’s individual femoral access options and relevant clinical features.

Every suspected incidence of this condition should be promptly reported to Teleflex using the contact information below as soon as practical. Your local sales representative can also assist with completing a report if needed.

Our records indicate you have received products that are subject to this FSCA.

Product is not being removed; you may continue to use the products in scope of this advisory notice per the additional instructions, warnings, and cautions contained herein.

Depending on your device location please adhere to the following Action list:

Device location	Action List Number
Medical facilities (hospitals, medical staff, etc.)	1
Distributors	2

Action list number 1 – Medical facilities

1. Immediately provide this advisory notice to all persons who need to be aware within your organisation (e.g., Coronary Care Unit, Interventional Cardiology Department, Cardiac Catheter Lab, etc.) or to any organisation where the potentially affected product has been transferred.
2. We request that you immediately check your inventory for product within the scope of this Urgent Medical Device Notification.
3. If you have affected product, mark the applicable checkbox on the Acknowledgement Form (Appendix 1) and return the form to Teleflex Customer Service at the contact details provided, and place a copy of this notification with all affected product. If you would like to return affected product, this can also be initiated by contacting Teleflex Customer Service at the contact details provided below.
4. If you do not have affected product, mark the applicable checkbox on the Acknowledgement Form (Appendix 1) and return the form to Teleflex at the contact details provided.

Action list number 2 – Distributors

1. Update the contact details on pages four and five from Teleflex customer service contact details to your contact details.
2. Immediately provide this field safety notice to all customers who have received affected product. Request that your customer complete the Acknowledgement Form (Appendix 1) and return to you.
3. We request that you immediately check your inventory for affected product in scope of this FSCA, refer to Appendix 2 for the list of affected codes and lots. Place a copy of this notification with all affected product and ensure that the notification is included with future distributions of affected product.

4. As a distributor, you are then required to confirm to Teleflex that you have completed the field activity outlined in actions 1 and 2 of this Action List Number 2. Upon completion of your actions, please forward the completed Acknowledgement Form to Customer Service.
5. Please be aware that all European Economic Area/Switzerland/United Kingdom (EEA/CH/UK) and Turkey Member State Competent Authorities in which Teleflex distributes directly will be notified by Teleflex.
6. If you have further distributed product outside of your country, please notify Teleflex Customer Service by return e-mail to the e-mail address below.
7. If you are a distributor and/or have a reporting responsibility within or outside the EEA/CH/TR/UK region, please notify your local competent authority of this action. Please forward the notification and all communication with your local competent authority to Teleflex.

Reporting Adverse Events

Adverse events or quality problems experienced with the use of this product should be reported to Teleflex Customer Service using the contact details provided below.

Transmission of this Advisory Notice

This advisory notice should be given to all persons who need to be aware within your organisation or to any organisation where the potentially affected product have been transferred.

Please consider end users, clinicians, risk managers, supply chain/distribution centers, service departments, etc., in the circulation of this notice. Maintain awareness of this notice until all required actions have been completed in your organisation.

Contact reference information

As always, real-time telephone support for Arrow IABPs and IAB catheters is available at the Patient Care Support contact details below. Should you require any further information or support concerning this issue, please contact Teleflex Customer Service via email, phone, or fax. Customer Service hours of operation are 8am-7pm EST.

24/7 Patient Care Support:

Telephone: (978) 250-5177 International

Customer Service:

Contact: Cliodhna Coffey

Telephone: +44 (0) 1494 532761

Email: Recalls.uk@teleflex.com

Teleflex is committed to providing high quality, safe and effective products. We regret any inconvenience this action may cause your operations. If you have any other questions, please contact your local Teleflex sales representative or Teleflex Customer Service.

The undersign confirms this notice has been notified to the appropriate Regulatory Authority.

For and on behalf of Teleflex,

Padraig Hegarty

Padraig Hegarty VP, Global QA (Manufacturing)

Appendix 1

Customer No

FIELD SAFETY CORRECTIVE ACTION
ACKNOWLEDGEMENT FORM

PRODUCT FIELD ACTION NOTICE BY TELEFLEX – IMMEDIATE ATTENTION REQUIRED
Ref. EIF-000561

RETURN COMPLETED FORM IMMEDIATELY TO:

E-mail: RECALLS.UK@TELEFLEX.COM

<input type="checkbox"/> We confirm receipt of this advisory notice and completion of the required actions contained therein. We further confirm that our inventory does NOT include products affected by this advisory notice.	<input type="checkbox"/> We confirm receipt of this advisory notice and completion of the required actions contained therein. We further confirm our inventory DOES include products affected by this advisory notice.
--	---

Complete this Acknowledgement Form and return the completed form immediately using the contact information above.

INSTITUTION NAME (E.G., NAME OF HOSPITAL, HEALTH CARE ORGANISATION)	
INSTITUTION ADDRESS	PHONE/FAX
FORM COMPLETED BY	Stamp
PRINT NAME: _____ SIGNATURE: _____	
DATE	

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-05830-LWS	18F23A0038	(01)10801902161892(17)241231(10)18F23A0038
IAB-05830-LWS	18F23B0023	(01)10801902161892(17)250131(10)18F23B0023
IAB-05830-LWS	18F23C0026	(01)10801902172843(17)250228(10)18F23C0026
IAB-05830-LWS	18F23D0024	(01)10801902161892(17)250430(10)18F23D0024
IAB-05830-LWS	18F23F0049	(01)10801902172843(17)250531(10)18F23F0049
IAB-05830-LWS	18F23H0060	(01)10801902161892(17)250731(10)18F23H0060
IAB-05830-LWS	18F23J0001	(01)10801902172843(17)250831(10)18F23J0001
IAB-05830-LWS	18F23J0075	(01)10801902161892(17)250930(10)18F23J0075
IAB-05830-LWS	18F23K0013	(01)10801902161892(17)250930(10)18F23K0013
IAB-05830-LWS	18F23L0019	(01)10801902161892(17)251031(10)18F23L0019
IAB-05830-LWS	18F23L0041	(01)10801902161892(17)251031(10)18F23L0041
IAB-05830-LWS	18F23L0054	(01)10801902172843(17)251031(10)18F23L0054
IAB-05830-LWS	18F23M0056	(01)10801902172843(17)251130(10)18F23M0056
IAB-05830-LWS	18F24A0015	(01)10801902172843(17)251231(10)18F24A0015
IAB-05830-LWS	18F24A0040	(01)10801902172843(17)260131(10)18F24A0040
IAB-05830-LWS	18F24B0008	(01)10801902161892(17)260131(10)18F24B0008
IAB-05830-LWS	18F24B0013	(01)10801902172843(17)260131(10)18F24B0013
IAB-05830-LWS	18F24C0058	(01)10801902161892(17)260228(10)18F24C0058
IAB-05830-LWS	18F24C0061	(01)10801902172843(17)260228(10)18F24C0061
IAB-05830-LWS	18F24C0088	(01)10801902172843(17)46112(10)18F24C0088
IAB-05830-LWS	18F24C0089	(01)10801902172843(17)46112(10)18F24C0089
IAB-05830-LWS	18F24C0101	(01)10801902161892(17)260228(10)18F24C0101
IAB-05830-LWS	18F24C0109	(01)10801902172843(17)260228(10)18F24C0109
IAB-05830-LWS	18F24C0110	(01)10801902172843(17)260228(10)18F24C0110
IAB-05830-LWS	18F24C0172	(01)10801902172843(17)260331(10)18F24C0172
IAB-05830-LWS	18F24C0173	(01)10801902172843(17)260331(10)18F24C0173
IAB-05830-LWS	18F24C0174	(01)10801902172843(17)46112(10)18F24C0174
IAB-05830-LWS	18F24C0175	(01)10801902172843(17)46112(10)18F24C0175
IAB-05830-LWS	18F24C0176	(01)10801902172843(17)46112(10)18F24C0176
IAB-05830-LWS	18F24C0185	(01)10801902172843(17)46112(10)18F24C0185
IAB-05830-LWS	18F24D0002	(01)10801902161892(17)260331(10)18F24D0002
IAB-05830-U	18F22F0023	(01)10801902172850(17)240531(10)18F22F0023
IAB-05830-U	18F22G0005	(01)10801902172850(17)240630(10)18F22G0005
IAB-05830-U	18F22G0010	(01)10801902172850(17)240630(10)18F22G0010
IAB-05830-U	18F22H0033	(01)10801902172850(17)240731(10)18F22H0033
IAB-05830-U	18F23E0032	(01)10801902182019(17)250430(10)18F23E0032
IAB-05830-U	18F23J0002	(01)10801902182019(17)250831(10)18F23J0002
IAB-05830-U	18F23J0031	(01)10801902172850(17)250831(10)18F23J0031
IAB-05830-U	18F23J0082	(01)10801902182019(17)250831(10)18F23J0082
IAB-05830-U	18F23K0025	(01)10801902182019(17)250930(10)18F23K0025
IAB-05830-U	18F23K0036	(01)10801902172850(17)250930(10)18F23K0036
IAB-05830-U	18F23K0042	(01)10801902172850(17)250930(10)18F23K0042
IAB-05830-U	18F23M0001	(01)10801902172850(17)251130(10)18F23M0001
IAB-05830-U	18F24C0131	(01)10801902182019(17)260331(10)18F24C0131
IAB-05840-LWS	18F22E0008	(01)10801902172867(17)240430(10)18F22E0008
IAB-05840-LWS	18F22E0029	(01)10801902172867(17)240430(10)18F22E0029
IAB-05840-LWS	18F22F0006	(01)10801902172867(17)240531(10)18F22F0006
IAB-05840-LWS	18F22F0018	(01)10801902172867(17)240531(10)18F22F0018

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-05840-LWS	18F22F0039	(01)10801902172867(17)240531(10)18F22F0039
IAB-05840-LWS	18F22F0072	(01)10801902167733(17)240531(10)18F22F0072
IAB-05840-LWS	18F22G0002	(01)10801902172867(17)240630(10)18F22G0002
IAB-05840-LWS	18F22G0003	(01)10801902172867(17)240630(10)18F22G0003
IAB-05840-LWS	18F22G0019	(01)10801902172867(17)240630(10)18F22G0019
IAB-05840-LWS	18F22G0021	(01)10801902167733(17)240630(10)18F22G0021
IAB-05840-LWS	18F22G0031	(01)10801902167733(17)240630(10)18F22G0031
IAB-05840-LWS	18F22G0046	(01)10801902167733(17)240630(10)18F22G0046
IAB-05840-LWS	18F22G0059	(01)10801902172867(17)240630(10)18F22G0059
IAB-05840-LWS	18F22H0009	(01)10801902167733(17)240731(10)18F22H0009
IAB-05840-LWS	18F22H0023	(01)10801902167733(17)240731(10)18F22H0023
IAB-05840-LWS	18F22H0035	(01)10801902172867(17)240731(10)18F22H0035
IAB-05840-LWS	18F22H0058	(01)10801902167733(17)240731(10)18F22H0058
IAB-05840-LWS	18F22J0025	(01)10801902172867(17)240831(10)18F22J0025
IAB-05840-LWS	18F22K0015	(01)10801902167733(17)240930(10)18F22K0015
IAB-05840-LWS	18F22K0016	(01)10801902172867(17)240930(10)18F22K0016
IAB-05840-LWS	18F22M0017	(01)10801902167733(17)241130(10)18F22M0017
IAB-05840-LWS	18F22M0018	(01)10801902167733(17)241130(10)18F22M0018
IAB-05840-LWS	18F23A0004	(01)10801902167733(17)241231(10)18F23A0004
IAB-05840-LWS	18F23A0005	(01)10801902167733(17)241231(10)18F23A0005
IAB-05840-LWS	18F23A0018	(01)10801902167733(17)241231(10)18F23A0018
IAB-05840-LWS	18F23A0026	(01)10801902167733(17)241231(10)18F23A0026
IAB-05840-LWS	18F23B0008	(01)10801902167733(17)250131(10)18F23B0008
IAB-05840-LWS	18F23B0016	(01)10801902167733(17)250131(10)18F23B0016
IAB-05840-LWS	18F23E0020	(01)10801902172867(17)250430(10)18F23E0020
IAB-05840-LWS	18F23E0054	(01)10801902167733(17)250531(10)18F23E0054
IAB-05840-LWS	18F23F0002	(01)10801902172867(17)250531(10)18F23F0002
IAB-05840-LWS	18F23F0026	(01)10801902172867(17)250531(10)18F23F0026
IAB-05840-LWS	18F23G0008	(01)10801902172867(17)250630(10)18F23G0008
IAB-05840-LWS	18F23G0017	(01)10801902167733(17)250630(10)18F23G0017
IAB-05840-LWS	18F23G0057	(01)10801902172867(17)250731(10)18F23G0057
IAB-05840-LWS	18F23H0013	(01)10801902172867(17)250731(10)18F23H0013
IAB-05840-LWS	18F23H0029	(01)10801902167733(17)250731(10)18F23H0029
IAB-05840-LWS	18F23H0055	(01)10801902172867(17)250731(10)18F23H0055
IAB-05840-LWS	18F23H0064	(01)10801902167733(17)250731(10)18F23H0064
IAB-05840-LWS	18F23J0003	(01)10801902172867(17)250831(10)18F23J0003
IAB-05840-LWS	18F23J0037	(01)10801902172867(17)250831(10)18F23J0037
IAB-05840-LWS	18F23J0072	(01)10801902172867(17)250831(10)18F23J0072
IAB-05840-LWS	18F23J0073	(01)10801902172867(17)250930(10)18F23J0073
IAB-05840-LWS	18F23K0054	(01)10801902172867(17)251031(10)18F23K0054
IAB-05840-LWS	18F23L0009	(01)10801902167733(17)251031(10)18F23L0009
IAB-05840-LWS	18F23L0028	(01)10801902167733(17)251031(10)18F23L0028
IAB-05840-LWS	18F23L0055	(01)10801902172867(17)251130(10)18F23L0055
IAB-05840-LWS	18F23M0043	(01)10801902172867(17)251130(10)18F23M0043
IAB-05840-LWS	18F23M0068	(01)10801902167733(17)251231(10)18F23M0068
IAB-05840-LWS	18F24A0025	(01)10801902172867(17)251231(10)18F24A0025
IAB-05840-LWS	18F24A0030	(01)10801902167733(17)251231(10)18F24A0030
IAB-05840-LWS	18F24A0031	(01)10801902172867(17)251231(10)18F24A0031

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-05840-LWS	18F24A0039	(01)10801902167733(17)251231(10)18F24A0039
IAB-05840-LWS	18F24B0005	(01)10801902172867(17)260131(10)18F24B0005
IAB-05840-LWS	18F24B0015	(01)10801902167733(17)260131(10)18F24B0015
IAB-05840-LWS	18F24B0031	(01)10801902167733(17)260131(10)18F24B0031
IAB-05840-LWS	18F24B0048	(01)10801902172867(17)260131(10)18F24B0048
IAB-05840-LWS	18F24B0052	(01)10801902172867(17)260131(10)18F24B0052
IAB-05840-LWS	18F24B0078	(01)10801902172867(17)260228(10)18F24B0078
IAB-05840-LWS	18F24C0008	(01)10801902167733(17)260228(10)18F24C0008
IAB-05840-LWS	18F24C0036	(01)10801902172867(17)260228(10)18F24C0036
IAB-05840-LWS	18F24C0064	(01)10801902172867(17)260228(10)18F24C0064
IAB-05840-LWS	18F24C0065	(01)10801902172867(17)260228(10)18F24C0065
IAB-05840-LWS	18F24C0067	(01)10801902172867(17)260228(10)18F24C0067
IAB-05840-LWS	18F24C0068	(01)10801902172867(17)260228(10)18F24C0068
IAB-05840-LWS	18F24C0069	(01)10801902167733(17)260228(10)18F24C0069
IAB-05840-LWS	18F24C0071	(01)10801902167733(17)260228(10)18F24C0071
IAB-05840-LWS	18F24C0072	(01)10801902167733(17)260228(10)18F24C0072
IAB-05840-LWS	18F24C0075	(01)10801902167733(17)260228(10)18F24C0075
IAB-05840-LWS	18F24C0076	(01)10801902167733(17)260228(10)18F24C0076
IAB-05840-LWS	18F24C0077	(01)10801902167733(17)260228(10)18F24C0077
IAB-05840-LWS	18F24C0078	(01)10801902167733(17)260228(10)18F24C0078
IAB-05840-LWS	18F24C0079	(01)10801902167733(17)260228(10)18F24C0079
IAB-05840-LWS	18F24C0080	(01)10801902167733(17)260228(10)18F24C0080
IAB-05840-LWS	18F24C0081	(01)10801902167733(17)260228(10)18F24C0081
IAB-05840-LWS	18F24C0083	(01)10801902167733(17)260331(10)18F24C0083
IAB-05840-LWS	18F24C0105	(01)10801902172867(17)260228(10)18F24C0105
IAB-05840-LWS	18F24C0186	(01)10801902167733(17)260331(10)18F24C0186
IAB-05840-LWS	18F24C0187	(01)10801902167733(17)260331(10)18F24C0187
IAB-05840-LWS	18F24C0188	(01)10801902167733(17)260331(10)18F24C0188
IAB-05840-LWS	18F24C0193	(01)10801902167733(17)260331(10)18F24C0193
IAB-05840-LWS	18F24D0020	(01)10801902167733(17)260331(10)18F24D0020
IAB-05840-LWS	18F24D0021	(01)10801902167733(17)260331(10)18F24D0021
IAB-05840-LWS	18F24D0022	(01)10801902167733(17)260331(10)18F24D0022
IAB-05840-LWS	18F24D0031	(01)10801902167733(17)260331(10)18F24D0031
IAB-05840-LWS	18F24D0032	(01)10801902167733(17)260331(10)18F24D0032
IAB-05840-LWS	18F24D0037	(01)10801902167733(17)260331(10)18F24D0037
IAB-05840-LWS	18F24D0038	(01)10801902167733(17)260331(10)18F24D0038
IAB-05840-LWS	18F24D0039	(01)10801902167733(17)260331(10)18F24D0039
IAB-05840-LWS	18F24D0042	(01)10801902167733(17)260331(10)18F24D0042
IAB-05840-LWS	18F24D0044	(01)10801902167733(17)260331(10)18F24D0044
IAB-05840-LWS	18F24D0045	(01)10801902167733(17)260331(10)18F24D0045
IAB-05840-LWS	18F24D0049	(01)10801902167733(17)260331(10)18F24D0049
IAB-05840-LWS	18F24D0050	(01)10801902167733(17)260331(10)18F24D0050
IAB-05840-LWS	18F24D0051	(01)10801902167733(17)260331(10)18F24D0051
IAB-05840-LWS	18F24D0054	(01)10801902167733(17)260331(10)18F24D0054
IAB-05840-LWS	18F24D0055	(01)10801902167733(17)260331(10)18F24D0055
IAB-05840-LWS	18F24D0072	(01)10801902167733(17)260331(10)18F24D0072
IAB-05840-LWS	18F24D0087	(01)10801902167733(17)260331(10)18F24D0087
IAB-05840-LWS	18F24D0088	(01)10801902167733(17)260331(10)18F24D0088

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-05840-LWS	18F24D0089	(01)10801902167733(17)260331(10)18F24D0089
IAB-05840-LWS	18F24D0090	(01)10801902167733(17)260331(10)18F24D0090
IAB-05840-LWS	18F24D0091	(01)10801902167733(17)260331(10)18F24D0091
IAB-05840-LWS	18F24D0092	(01)10801902167733(17)260331(10)18F24D0092
IAB-05840-U	18F22E0012	(01)10801902172874(17)240430(10)18F22E0012
IAB-05840-U	18F22G0011	(01)10801902172874(17)240630(10)18F22G0011
IAB-05840-U	18F22G0016	(01)10801902172874(17)240630(10)18F22G0016
IAB-05840-U	18F22G0051	(01)10801902161922(17)240630(10)18F22G0051
IAB-05840-U	18F23A0002	(01)10801902161922(17)241231(10)18F23A0002
IAB-05840-U	18F23A0021	(01)10801902161922(17)241231(10)18F23A0021
IAB-05840-U	18F23A0060	(01)10801902161922(17)241231(10)18F23A0060
IAB-05840-U	18F23G0068	(01)10801902161922(17)250731(10)18F23G0068
IAB-05840-U	18F23K0008	(01)10801902172874(17)251130(10)18F23K0008
IAB-05840-U	18F23K0012	(01)10801902161922(17)250930(10)18F23K0012
IAB-05840-U	18F23K0039	(01)10801902172874(17)250930(10)18F23K0039
IAB-05840-U	18F23K0053	(01)10801902161922(17)251031(10)18F23K0053
IAB-05840-U	18F23K0063	(01)10801902161922(17)251031(10)18F23K0063
IAB-05840-U	18F23L0010	(01)10801902172874(17)251031(10)18F23L0010
IAB-05840-U	18F23L0031	(01)10801902172874(17)251031(10)18F23L0031
IAB-05840-U	18F23L0039	(01)10801902172874(17)251031(10)18F23L0039
IAB-05840-U	18F24B0051	(01)10801902161922(17)260131(10)18F24B0051
IAB-05850-LWS	18F22J0037	(01)10801902167726(17)240831(10)18F22J0037(13)220927
IAB-05850-LWS	18F22J0040	(01)10801902167726(17)240831(10)18F22J0040(13)220929
IAB-05850-LWS	18F22K0044	(01)10801902167726(17)240930(10)18F22K0044(13)221021
IAB-05850-LWS	18F22K0045	(01)10801902167726(17)240930(10)18F22K0045(13)221021
IAB-05850-LWS	18F22K0056	(01)10801902167726(17)241031(10)18F22K0056(13)221028
IAB-05850-LWS	18F22L0012	(01)10801902167726(17)241031(10)18F22L0012(13)221104
IAB-05850-LWS	18F23K0006	(01)10801902167726(17)250930(10)18F23K0006(13)231031
IAB-05850-LWS	18F23K0038	(01)10801902172881(17)250930(10)18F23K0038(13)231028
IAB-05850-LWS	18F24B0049	(01)10801902167726(17)260131(10)18F24B0049(13)240227
IAB-05850-LWS	18F24B0075	(01)10801902167726(17)260228(10)18F24B0075(13)240301
IAB-05850-LWS	18F24C0031	(01)10801902172881(17)260228(10)18F24C0031(13)240316
IAB-05850-LWS	18F24C0032	(01)10801902172881(17)260228(10)18F24C0032(13)240331
IAB-05850-LWS	18F24C0033	(01)10801902172881(17)260228(10)18F24C0033(13)240315
IAB-05850-LWS	18F24C0034	(01)10801902172881(17)260228(10)18F24C0034(13)240315
IAB-06830-U	18F22E0062	(01)10801902172898(17)240430(10)18F22E0062
IAB-06830-U	18F22F0007	(01)10801902172898(17)240531(10)18F22F0007
IAB-06830-U	18F22F0017	(01)10801902172898(17)240531(10)18F22F0017
IAB-06830-U	18F22F0020	(01)10801902172898(17)240531(10)18F22F0020
IAB-06830-U	18F22F0034	(01)10801902172898(17)240531(10)18F22F0034
IAB-06830-U	18F22F0045	(01)10801902172898(17)240531(10)18F22F0045
IAB-06830-U	18F22F0057	(01)10801902172898(17)240531(10)18F22F0057
IAB-06830-U	18F22G0001	(01)10801902172898(17)240630(10)18F22G0001
IAB-06830-U	18F22G0004	(01)10801902172898(17)240630(10)18F22G0004
IAB-06830-U	18F22G0007	(01)10801902172898(17)240630(10)18F22G0007
IAB-06830-U	18F22G0014	(01)10801902172898(17)240630(10)18F22G0014
IAB-06830-U	18F22H0002	(01)10801902172898(17)240731(10)18F22H0002
IAB-06830-U	18F22H0008	(01)10801902161939(17)240731(10)18F22H0008

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06830-U	18F22H0024	(01)10801902172898(17)240731(10)18F22H0024
IAB-06830-U	18F22H0029	(01)10801902172898(17)240731(10)18F22H0029
IAB-06830-U	18F22H0034	(01)10801902172898(17)240731(10)18F22H0034
IAB-06830-U	18F22J0009	(01)10801902172898(17)240831(10)18F22J0009
IAB-06830-U	18F22M0019	(01)10801902161939(17)241130(10)18F22M0019
IAB-06830-U	18F23A0027	(01)10801902161939(17)241231(10)18F23A0027
IAB-06830-U	18F23A0039	(01)10801902161939(17)241231(10)18F23A0039
IAB-06830-U	18F23B0006	(01)10801902161939(17)250131(10)18F23B0006
IAB-06830-U	18F23B0020	(01)10801902161939(17)250131(10)18F23B0020
IAB-06830-U	18F23B0032	(01)10801902161939(17)250131(10)18F23B0032
IAB-06830-U	18F23D0029	(01)10801902172898(17)250430(10)18F23D0029
IAB-06830-U	18F23E0033	(01)10801902172898(17)250531(10)18F23E0033
IAB-06830-U	18F23E0037	(01)10801902172898(17)250430(10)18F23E0037
IAB-06830-U	18F23E0038	(01)10801902172898(17)250430(10)18F23E0038
IAB-06830-U	18F23E0057	(01)10801902172898(17)250531(10)18F23E0057
IAB-06830-U	18F23F0023	(01)10801902172898(17)250531(10)18F23F0023
IAB-06830-U	18F23F0045	(01)10801902172898(17)250531(10)18F23F0045
IAB-06830-U	18F23G0025	(01)10801902172898(17)250630(10)18F23G0025
IAB-06830-U	18F23G0026	(01)10801902172898(17)250630(10)18F23G0026
IAB-06830-U	18F23G0051	(01)10801902172898(17)250630(10)18F23G0051
IAB-06830-U	18F23G0066	(01)10801902161939(17)250630(10)18F23G0066
IAB-06830-U	18F23G0067	(01)10801902172898(17)250731(10)18F23G0067
IAB-06830-U	18F23H0009	(01)10801902172898(17)250731(10)18F23H0009
IAB-06830-U	18F23H0011	(01)10801902172898(17)250831(10)18F23H0011
IAB-06830-U	18F23H0025	(01)10801902172898(17)250731(10)18F23H0025
IAB-06830-U	18F23H0028	(01)10801902172898(17)250731(10)18F23H0028
IAB-06830-U	18F23H0059	(01)10801902161939(17)250731(10)18F23H0059
IAB-06830-U	18F23H0069	(01)10801902172898(17)250731(10)18F23H0069
IAB-06830-U	18F23H0070	(01)10801902161939(17)250731(10)18F23H0070
IAB-06830-U	18F23H0074	(01)10801902161939(17)250731(10)18F23H0074
IAB-06830-U	18F23H0080	(01)10801902172898(17)250731(10)18F23H0080
IAB-06830-U	18F23J0004	(01)10801902172898(17)250831(10)18F23J0004
IAB-06830-U	18F23J0011	(01)10801902172898(17)250831(10)18F23J0011
IAB-06830-U	18F23J0015	(01)10801902172898(17)250831(10)18F23J0015
IAB-06830-U	18F23J0046	(01)10801902161939(17)250831(10)18F23J0046
IAB-06830-U	18F23J0053	(01)10801902172898(17)250831(10)18F23J0053
IAB-06830-U	18F23J0054	(01)10801902172898(17)250831(10)18F23J0054
IAB-06830-U	18F23J0055	(01)10801902172898(17)250831(10)18F23J0055
IAB-06830-U	18F23J0079	(01)10801902172898(17)250930(10)18F23J0079
IAB-06830-U	18F23K0003	(01)10801902172898(17)250930(10)18F23K0003
IAB-06830-U	18F23K0005	(01)10801902172898(17)250930(10)18F23K0005
IAB-06830-U	18F23K0009	(01)10801902172898(17)250930(10)18F23K0009
IAB-06830-U	18F23K0051	(01)10801902172898(17)250930(10)18F23K0051
IAB-06830-U	18F23K0059	(01)10801902161939(17)250930(10)18F23K0059
IAB-06830-U	18F23K0061	(01)10801902172898(17)250930(10)18F23K0061
IAB-06830-U	18F23L0040	(01)10801902172898(17)251031(10)18F23L0040
IAB-06830-U	18F23M0002	(01)10801902172898(17)251130(10)18F23M0002
IAB-06830-U	18F23M0044	(01)10801902172898(17)251130(10)18F23M0044

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06830-U	18F23M0049	(01)10801902172898(17)251130(10)18F23M0049
IAB-06830-U	18F23M0053	(01)10801902172898(17)251130(10)18F23M0053
IAB-06830-U	18F23M0054	(01)10801902172898(17)251130(10)18F23M0054
IAB-06830-U	18F23M0055	(01)10801902172898(17)251231(10)18F23M0055
IAB-06830-U	18F24A0006	(01)10801902172898(17)251231(10)18F24A0006
IAB-06830-U	18F24A0012	(01)10801902172898(17)251231(10)18F24A0012
IAB-06830-U	18F24A0013	(01)10801902172898(17)251231(10)18F24A0013
IAB-06830-U	18F24A0021	(01)10801902172898(17)251231(10)18F24A0021
IAB-06830-U	18F24A0036	(01)10801902161939(17)251231(10)18F24A0036
IAB-06830-U	18F24B0014	(01)10801902172898(17)260131(10)18F24B0014
IAB-06830-U	18F24C0004	(01)10801902172898(17)260228(10)18F24C0004
IAB-06830-U	18F24C0005	(01)10801902172898(17)260228(10)18F24C0005
IAB-06830-U	18F24D0004	(01)10801902161939(17)260331(10)18F24D0004
IAB-06830-U	18F24D0033	(01)10801902172898(17)260331(10)18F24D0033
IAB-06830-U	18F24D0036	(01)10801902172898(17)260331(10)18F24D0036
IAB-06830-U	18F24D0043	(01)10801902172898(17)260331(10)18F24D0043
IAB-06830-U	18F24D0048	(01)10801902172898(17)260331(10)18F24D0048
IAB-06830-U	18F24D0086	(01)10801902172898(17)260331(10)18F24D0086
IAB-06840-U	18F22E0001	(01)10801902172904(17)240430(10)18F22E0001
IAB-06840-U	18F22E0009	(01)10801902172904(17)240430(10)18F22E0009
IAB-06840-U	18F22E0014	(01)10801902172904(17)240430(10)18F22E0014
IAB-06840-U	18F22E0020	(01)10801902172904(17)240430(10)18F22E0020
IAB-06840-U	18F22E0023	(01)10801902161946(17)240430(10)18F22E0023
IAB-06840-U	18F22E0036	(01)10801902172904(17)240430(10)18F22E0036
IAB-06840-U	18F22E0037	(01)10801902172904(17)240430(10)18F22E0037
IAB-06840-U	18F22E0042	(01)10801902172904(17)240430(10)18F22E0042
IAB-06840-U	18F22E0046	(01)10801902172904(17)240430(10)18F22E0046
IAB-06840-U	18F22E0048	(01)10801902172904(17)240430(10)18F22E0048
IAB-06840-U	18F22E0049	(01)10801902172904(17)240430(10)18F22E0049
IAB-06840-U	18F22E0061	(01)10801902172904(17)240430(10)18F22E0061
IAB-06840-U	18F22E0065	(01)10801902172904(17)240430(10)18F22E0065
IAB-06840-U	18F22E0066	(01)10801902172904(17)240430(10)18F22E0066
IAB-06840-U	18F22F0002	(01)10801902172904(17)240531(10)18F22F0002
IAB-06840-U	18F22F0009	(01)10801902161946(17)240531(10)18F22F0009
IAB-06840-U	18F22F0010	(01)10801902172904(17)240531(10)18F22F0010
IAB-06840-U	18F22F0016	(01)10801902172904(17)240531(10)18F22F0016
IAB-06840-U	18F22F0019	(01)10801902161946(17)240531(10)18F22F0019
IAB-06840-U	18F22F0021	(01)10801902172904(17)240531(10)18F22F0021
IAB-06840-U	18F22F0022	(01)10801902172904(17)240531(10)18F22F0022
IAB-06840-U	18F22F0037	(01)10801902172904(17)240531(10)18F22F0037
IAB-06840-U	18F22F0043	(01)10801902172904(17)240531(10)18F22F0043
IAB-06840-U	18F22F0047	(01)10801902172904(17)240531(10)18F22F0047
IAB-06840-U	18F22F0050	(01)10801902172904(17)240531(10)18F22F0050
IAB-06840-U	18F22F0051	(01)10801902172904(17)240531(10)18F22F0051
IAB-06840-U	18F22F0054	(01)10801902172904(17)240531(10)18F22F0054
IAB-06840-U	18F22F0065	(01)10801902172904(17)240531(10)18F22F0065
IAB-06840-U	18F22F0066	(01)10801902172904(17)240531(10)18F22F0066
IAB-06840-U	18F22F0067	(01)10801902172904(17)240531(10)18F22F0067

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06840-U	18F22G0067	(01)10801902172904(17)240630(10)18F22G0067
IAB-06840-U	18F22H0004	(01)10801902172904(17)240731(10)18F22H0004
IAB-06840-U	18F22H0010	(01)10801902172904(17)240731(10)18F22H0010
IAB-06840-U	18F22H0014	(01)10801902161946(17)240731(10)18F22H0014
IAB-06840-U	18F22H0026	(01)10801902172904(17)240531(10)18F22H0026
IAB-06840-U	18F22H0028	(01)10801902161946(17)240731(10)18F22H0028
IAB-06840-U	18F22H0030	(01)10801902172904(17)240731(10)18F22H0030
IAB-06840-U	18F22H0036	(01)10801902161946(17)240731(10)18F22H0036
IAB-06840-U	18F22H0038	(01)10801902172904(17)240731(10)18F22H0038
IAB-06840-U	18F22H0039	(01)10801902172904(17)240731(10)18F22H0039
IAB-06840-U	18F22K0004	(01)10801902172904(17)240930(10)18F22K0004
IAB-06840-U	18F22M0015	(01)10801902161946(17)241130(10)18F22M0015
IAB-06840-U	18F23A0019	(01)10801902161946(17)241231(10)18F23A0019
IAB-06840-U	18F23A0025	(01)10801902161946(17)250228(10)18F23A0025
IAB-06840-U	18F23A0037	(01)10801902161946(17)241231(10)18F23A0037
IAB-06840-U	18F23A0054	(01)10801902161946(17)241231(10)18F23A0054
IAB-06840-U	18F23A0055	(01)10801902161946(17)241231(10)18F23A0055
IAB-06840-U	18F23A0061	(01)10801902161946(17)241231(10)18F23A0061
IAB-06840-U	18F23A0066	(01)10801902161946(17)250131(10)18F23A0066
IAB-06840-U	18F23A0067	(01)10801902161946(17)250131(10)18F23A0067
IAB-06840-U	18F23B0018	(01)10801902161946(17)250228(10)18F23B0018
IAB-06840-U	18F23C0017	(01)10801902172904(17)250228(10)18F23C0017
IAB-06840-U	18F23C0027	(01)10801902172904(17)250228(10)18F23C0027
IAB-06840-U	18F23C0044	(01)10801902172904(17)250228(10)18F23C0044
IAB-06840-U	18F23D0015	(01)10801902172904(17)250331(10)18F23D0015
IAB-06840-U	18F23D0018	(01)10801902161946(17)250331(10)18F23D0018
IAB-06840-U	18F23D0027	(01)10801902172904(17)250430(10)18F23D0027
IAB-06840-U	18F23D0028	(01)10801902172904(17)250430(10)18F23D0028
IAB-06840-U	18F23E0013	(01)10801902161946(17)250430(10)18F23E0013
IAB-06840-U	18F23E0014	(01)10801902172904(17)250430(10)18F23E0014
IAB-06840-U	18F23E0015	(01)10801902161946(17)250430(10)18F23E0015
IAB-06840-U	18F23E0028	(01)10801902172904(17)250430(10)18F23E0028
IAB-06840-U	18F23E0035	(01)10801902172904(17)250430(10)18F23E0035
IAB-06840-U	18F23E0036	(01)10801902172904(17)250430(10)18F23E0036
IAB-06840-U	18F23E0050	(01)10801902172904(17)250430(10)18F23E0050
IAB-06840-U	18F23E0051	(01)10801902172904(17)250430(10)18F23E0051
IAB-06840-U	18F23E0052	(01)10801902172904(17)250430(10)18F23E0052
IAB-06840-U	18F23E0055	(01)10801902172904(17)250531(10)18F23E0055
IAB-06840-U	18F23F0003	(01)10801902172904(17)250531(10)18F23F0003
IAB-06840-U	18F23F0006	(01)10801902172904(17)250531(10)18F23F0006
IAB-06840-U	18F23F0007	(01)10801902172904(17)250531(10)18F23F0007
IAB-06840-U	18F23F0014	(01)10801902172904(17)250531(10)18F23F0014
IAB-06840-U	18F23F0015	(01)10801902172904(17)250531(10)18F23F0015
IAB-06840-U	18F23F0024	(01)10801902172904(17)250531(10)18F23F0024
IAB-06840-U	18F23F0025	(01)10801902172904(17)250531(10)18F23F0025
IAB-06840-U	18F23F0048	(01)10801902172904(17)250531(10)18F23F0048
IAB-06840-U	18F23F0052	(01)10801902172904(17)250531(10)18F23F0052
IAB-06840-U	18F23F0054	(01)10801902172904(17)250531(10)18F23F0054

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06840-U	18F23F0059	(01)10801902172904(17)250531(10)18F23F0059
IAB-06840-U	18F23G0002	(01)10801902161946(17)250630(10)18F23G0002
IAB-06840-U	18F23G0003	(01)10801902161946(17)250630(10)18F23G0003
IAB-06840-U	18F23G0005	(01)10801902172904(17)250630(10)18F23G0005
IAB-06840-U	18F23G0007	(01)10801902172904(17)250630(10)18F23G0007
IAB-06840-U	18F23G0011	(01)10801902161946(17)250630(10)18F23G0011
IAB-06840-U	18F23G0014	(01)10801902172904(17)250630(10)18F23G0014
IAB-06840-U	18F23G0028	(01)10801902172904(17)250630(10)18F23G0028
IAB-06840-U	18F23G0050	(01)10801902172904(17)250630(10)18F23G0050
IAB-06840-U	18F23G0053	(01)10801902172904(17)250630(10)18F23G0053
IAB-06840-U	18F23G0063	(01)10801902161946(17)250731(10)18F23G0063
IAB-06840-U	18F23G0064	(01)10801902172904(17)250731(10)18F23G0064
IAB-06840-U	18F23G0065	(01)10801902172904(17)250731(10)18F23G0065
IAB-06840-U	18F23H0033	(01)10801902172904(17)250831(10)18F23H0033
IAB-06840-U	18F23H0034	(01)10801902161946(17)250731(10)18F23H0034
IAB-06840-U	18F23H0035	(01)10801902161946(17)250731(10)18F23H0035
IAB-06840-U	18F23H0038	(01)10801902161946(17)250731(10)18F23H0038
IAB-06840-U	18F23H0053	(01)10801902161946(17)250731(10)18F23H0053
IAB-06840-U	18F23H0057	(01)10801902172904(17)250731(10)18F23H0057
IAB-06840-U	18F23H0058	(01)10801902161946(17)250731(10)18F23H0058
IAB-06840-U	18F23H0071	(01)10801902161946(17)250731(10)18F23H0071
IAB-06840-U	18F23H0075	(01)10801902172904(17)250731(10)18F23H0075
IAB-06840-U	18F23J0006	(01)10801902161946(17)250831(10)18F23J0006
IAB-06840-U	18F23J0008	(01)10801902161946(17)250831(10)18F23J0008
IAB-06840-U	18F23J0014	(01)10801902161946(17)250831(10)18F23J0014
IAB-06840-U	18F23J0018	(01)10801902161946(17)250831(10)18F23J0018
IAB-06840-U	18F23J0019	(01)10801902172904(17)250831(10)18F23J0019
IAB-06840-U	18F23J0035	(01)10801902161946(17)250831(10)18F23J0035
IAB-06840-U	18F23J0041	(01)10801902172904(17)250831(10)18F23J0041
IAB-06840-U	18F23J0042	(01)10801902161946(17)250831(10)18F23J0042
IAB-06840-U	18F23J0050	(01)10801902172904(17)250831(10)18F23J0050
IAB-06840-U	18F23K0017	(01)10801902172904(17)250930(10)18F23K0017
IAB-06840-U	18F23K0018	(01)10801902172904(17)250930(10)18F23K0018
IAB-06840-U	18F23K0019	(01)10801902172904(17)250930(10)18F23K0019
IAB-06840-U	18F23K0027	(01)10801902172904(17)250930(10)18F23K0027
IAB-06840-U	18F23K0028	(01)10801902161946(17)250930(10)18F23K0028
IAB-06840-U	18F23K0040	(01)10801902172904(17)250930(10)18F23K0040
IAB-06840-U	18F23K0045	(01)10801902172904(17)250930(10)18F23K0045
IAB-06840-U	18F23K0057	(01)10801902172904(17)250930(10)18F23K0057
IAB-06840-U	18F23K0060	(01)10801902172904(17)251031(10)18F23K0060
IAB-06840-U	18F23L0006	(01)10801902172904(17)251031(10)18F23L0006
IAB-06840-U	18F23L0029	(01)10801902172904(17)251031(10)18F23L0029
IAB-06840-U	18F23L0030	(01)10801902172904(17)251031(10)18F23L0030
IAB-06840-U	18F23M0019	(01)10801902172904(17)251130(10)18F23M0019
IAB-06840-U	18F23M0020	(01)10801902172904(17)251130(10)18F23M0020
IAB-06840-U	18F23M0037	(01)10801902172904(17)251130(10)18F23M0037
IAB-06840-U	18F23M0039	(01)10801902172904(17)251130(10)18F23M0039
IAB-06840-U	18F23M0040	(01)10801902172904(17)251130(10)18F23M0040

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06840-U	18F23M0041	(01)10801902172904(17)251130(10)18F23M0041
IAB-06840-U	18F23M0064	(01)10801902172904(17)251231(10)18F23M0064
IAB-06840-U	18F23M0065	(01)10801902172904(17)251231(10)18F23M0065
IAB-06840-U	18F24A0002	(01)10801902172904(17)251231(10)18F24A0002
IAB-06840-U	18F24A0003	(01)10801902172904(17)251231(10)18F24A0003
IAB-06840-U	18F24A0004	(01)10801902172904(17)251231(10)18F24A0004
IAB-06840-U	18F24A0005	(01)10801902172904(17)251231(10)18F24A0005
IAB-06840-U	18F24A0014	(01)10801902172904(17)251231(10)18F24A0014
IAB-06840-U	18F24A0016	(01)10801902172904(17)251231(10)18F24A0016
IAB-06840-U	18F24A0022	(01)10801902172904(17)251231(10)18F24A0022
IAB-06840-U	18F24A0023	(01)10801902172904(17)251231(10)18F24A0023
IAB-06840-U	18F24A0024	(01)10801902172904(17)251231(10)18F24A0024
IAB-06840-U	18F24A0038	(01)10801902172904(17)251231(10)18F24A0038
IAB-06840-U	18F24B0006	(01)10801902172904(17)260131(10)18F24B0006
IAB-06840-U	18F24B0007	(01)10801902172904(17)260131(10)18F24B0007
IAB-06840-U	18F24B0023	(01)10801902172904(17)260131(10)18F24B0023
IAB-06840-U	18F24B0024	(01)10801902172904(17)260131(10)18F24B0024
IAB-06840-U	18F24B0025	(01)10801902161946(17)260131(10)18F24B0025
IAB-06840-U	18F24B0026	(01)10801902161946(17)260131(10)18F24B0026
IAB-06840-U	18F24B0027	(01)10801902172904(17)260131(10)18F24B0027
IAB-06840-U	18F24B0028	(01)10801902172904(17)260131(10)18F24B0028
IAB-06840-U	18F24B0045	(01)10801902172904(17)260131(10)18F24B0045
IAB-06840-U	18F24B0046	(01)10801902172904(17)260131(10)18F24B0046
IAB-06840-U	18F24B0047	(01)10801902172904(17)260131(10)18F24B0047
IAB-06840-U	18F24B0067	(01)10801902172904(17)260228(10)18F24B0067
IAB-06840-U	18F24B0068	(01)10801902172904(17)260131(10)18F24B0068
IAB-06840-U	18F24B0069	(01)10801902172904(17)260131(10)18F24B0069
IAB-06840-U	18F24B0070	(01)10801902172904(17)260228(10)18F24B0070
IAB-06840-U	18F24B0071	(01)10801902172904(17)260228(10)18F24B0071
IAB-06840-U	18F24C0006	(01)10801902172904(17)260228(10)18F24C0006
IAB-06840-U	18F24C0007	(01)10801902172904(17)260228(10)18F24C0007
IAB-06840-U	18F24C0028	(01)10801902172904(17)260228(10)18F24C0028
IAB-06840-U	18F24C0029	(01)10801902172904(17)260228(10)18F24C0029
IAB-06840-U	18F24C0030	(01)10801902172904(17)260228(10)18F24C0030
IAB-06840-U	18F24C0038	(01)10801902172904(17)260228(10)18F24C0038
IAB-06840-U	18F24C0092	(01)10801902172904(17)260228(10)18F24C0092
IAB-06840-U	18F24C0120	(01)10801902172904(17)260228(10)18F24C0120
IAB-06840-U	18F24C0121	(01)10801902172904(17)260228(10)18F24C0121
IAB-06840-U	18F24C0141	(01)10801902172904(17)260228(10)18F24C0141
IAB-06840-U	18F24C0151	(01)10801902161946(17)260228(10)18F24C0151
IAB-06840-U	18F24C0171	(01)10801902161946(17)260331(10)18F24C0171
IAB-06840-U	18F24C0177	(01)10801902161946(17)260331(10)18F24C0177
IAB-06840-U	18F24C0178	(01)10801902161946(17)260331(10)18F24C0178
IAB-06840-U	18F24C0179	(01)10801902161946(17)260331(10)18F24C0179
IAB-06840-U	18F24C0180	(01)10801902161946(17)260331(10)18F24C0180
IAB-06840-U	18F24C0195	(01)10801902161946(17)260331(10)18F24C0195
IAB-06840-U	18F24D0014	(01)10801902161946(17)260331(10)18F24D0014
IAB-06840-U	18F24D0017	(01)10801902161946(17)260331(10)18F24D0017

Appendix 2: EIF-000561 - Product code, Lot Number, Unique Device Identifier (UDI) Information

Product Code	Lot Number	Unique Device Identifier (UDI)
IAB-06840-U	18F24D0030	(01)10801902161946(17)260331(10)18F24D0030
IAB-06840-U	18R23G0002	(01)10801902172904(17)250331(10)18R23G0002
IAB-06850-U	18F22J0020	(01)10801902144192(17)240831(10)18F22J0020(13)220916
IAB-06850-U	18F22J0038	(01)10801902144192(17)240831(10)18F22J0038(13)220928
IAB-06850-U	18F22J0043	(01)10801902144192(17)240831(10)18F22J0043(13)220930
IAB-06850-U	18F22K0001	(01)10801902144192(17)240930(10)18F22K0001(13)221003
IAB-06850-U	18F22K0003	(01)10801902144192(17)240930(10)18F22K0003(13)221004
IAB-06850-U	18F22K0006	(01)10801902144192(17)240930(10)18F22K0006(13)221006
IAB-06850-U	18F22K0011	(01)10801902144192(17)240930(10)18F22K0011(13)221007
IAB-06850-U	18F22K0012	(01)10801902144192(17)240930(10)18F22K0012(13)221007
IAB-06850-U	18F22K0013	(01)10801902144192(17)240930(10)18F22K0013(13)221007
IAB-06850-U	18F23A0075	(01)10801902144192(17)241231(10)18F23A0075(13)230131
IAB-06850-U	18F23B0005	(01)10801902144192(17)250131(10)18F23B0005(13)230203
IAB-06850-U	18F23B0010	(01)10801902144192(17)250131(10)18F23B0010(13)230206
IAB-06850-U	18F23B0029	(01)10801902144192(17)250131(10)18F23B0029(13)230220
IAB-06850-U	18F23B0030	(01)10801902144192(17)250131(10)18F23B0030(13)230220
IAB-06850-U	18F23C0007	(01)10801902144192(17)250228(10)18F23C0007(13)230307
IAB-06850-U	18F23C0008	(01)10801902144192(17)250228(10)18F23C0008(13)230307
IAB-06850-U	18F23C0014	(01)10801902144192(17)250228(10)18F23C0014(13)230310
IAB-06850-U	18F23C0015	(01)10801902144192(17)250228(10)18F23C0015(13)230310
IAB-06850-U	18F23F0016	(01)10801902144192(17)250531(10)18F23F0016(13)230609
IAB-06850-U	18F23F0017	(01)10801902144192(17)250531(10)18F23F0017(13)230609
IAB-06850-U	18F23H0061	(01)10801902172911(17)250831(10)18F23H0061(13)230911
IAB-06850-U	18F23J0043	(01)10801902144192(17)250831(10)18F23J0043(13)230921
IAB-06850-U	18F23J0044	(01)10801902144192(17)250831(10)18F23J0044(13)230923
IAB-06850-U	18F23J0078	(01)10801902144192(17)250930(10)18F23J0078(13)231031
IAB-06850-U	18F23K0015	(01)10801902144192(17)250930(10)18F23K0015(13)231031
IAB-06850-U	18F23K0024	(01)10801902144192(17)250930(10)18F23K0024(13)231014
IAB-06850-U	18F23L0045	(01)10801902144192(17)251031(10)18F23L0045(13)231130
IAB-06850-U	18F23L0052	(01)10801902144192(17)251130(10)18F23L0052(13)231205
IAB-06850-U	18F23L0058	(01)10801902144192(17)251130(10)18F23L0058(13)231205
IAB-06850-U	18F24B0010	(01)10801902172911(17)260131(10)18F24B0010(13)240207
IAB-06850-U	18F24B0011	(01)10801902144192(17)260131(10)18F24B0011(13)240209
IAB-06850-U	18F24B0012	(01)10801902144192(17)260131(10)18F24B0012(13)240209

-End of Document-